



# DEALER SERVICE BULLETIN



WE SUPPORT  
VOLUNTARY TECHNICIAN  
CERTIFICATION

Bulletin	87-5-13B
Date	Feb. '93
Ref. No.	87-240-5
Corp. Ref. No.	035002R

**SUBJECT: POWERMASTER BRAKES (DIAGNOSTIC INFORMATION/ INSTALL NEW KIT)**

**MODELS AFFECTED: 1986 LESABRE/ELECTRA ESTATE WAGON  
1985-87 REGAL WITH 3.8 S. F. ■. TURBO**

This bulletin has been revised to include more diagnostics and introduces new repair kits for rebuilding the Powermaster unit. Please discard Bulletin 87-5-13A and replace it with this bulletin.

This bulletin provides **brake** diagnostic information that will help to correctly diagnose and resolve concerns with the Powermaster Brake System.

If, after following this procedure a technician still has a question, Delco Chassis Division has set up an 800 number for additional assistance.

Call: 1-800-523-0203

## CONDITION:

Some owners of 1986 LeSabre/Electra Estate wagons or 1985-87 Buick Regal Turbo vehicles equipped with the Powermaster Brake System may experience either "harder pedal feel" or "increased pedal travel". The red brake warning light may also be illuminated. This should normally coincide with the hard pedal feel or warn of impending hard pedal if a concern is not resolved. It may also momentarily or continuously illuminate in conjunction with the increase pedal travel problem.

## CAUSE:

A. "Harder Pedal Feel" symptoms can be diagnosed from this bulletin. There are four likely causes to be aware of:

1. **ACCUMULATOR WITH LOW GAS CHARGE:** Symptoms - Pedal is momentarily hard and/or brake warning light flickers on normal to fast brake applies.
2. **PRESSURE SWITCH FAILURE:** Symptoms - Pedal remains hard on all applies and pump fails to run.
3. **PUMP FAILURE:** Symptoms - Pedal remains hard on all applies and pump fails to run or may run continuously (with or without brake application).



# DEALER SERVICE BULLETIN



WE SUPPORT  
VOLUNTARY TECHNICIAN  
CERTIFICATION

Bulletin	87-5-13B
Date	Feb. '93
Ref. No.	87-240-5
Corp. Ref. No.	035002R

**SUBJECT :** POWERMASTER BRAKES (DIAGNOSTIC INFORMATION/ INSTALL NEW KIT)

**MODELS AFFECTED:** 1986 LESABRE/ELECTRA ESTATE WAGON  
1985-87 REGAL WITH 3.8 S.F.I. TURBO

This bulletin has been revised to include more diagnostics and introduces new repair kits for rebuilding the Powermaster unit. **Please discard Bulletin 87-5-13A** and replace it with this bulletin.

This bulletin provides brake diagnostic information that will help to correctly diagnose and resolve concerns with the Powermaster Brake System.

If, after following this procedure a technician still has a question, Delco Chassis Division has set up an 800 number for additional assistance.

Call : 1-800-523-0203

## CONDITION:

Some owners of 1986 LeSabre/Electra Estate wagons or 1985-87 Buick Regal Turbo vehicles equipped with the Powermaster hake System may experience either "harder pedal feel" or "increased pedal travel". The red brake warning light may also be illuminated. This should normally coincide with the hard pedal feel or warn of impending hard pedal if a concern is not resolved. It may also momentarily or continuously illuminate in conjunction with the increase pedal travel problem.

## CAUSE:

A. "Harder Pedal Feel" symptoms can be diagnosed from this bulletin. There are four likely causes to be aware of:

1. **ACCUMULATOR WITH LOW GAS CHARGE:** Symptoms - Pedal is momentarily hard and/or brake warning light flickers on normal to fast brake applies.
2. **PRESSURE SWITCH FAILURE:** Symptoms - Pedal remains hard on all applies and pump fails to run.
3. **PUMP FAILURE:** 'symptoms - Pedal remains hard on all applies and pump fails to run or may run continuously (with or without brake application).

4. **INTERNAL OR EXTERNAL LEAKAGE:** Symptoms - Pedal remains hard on most or all applies. Brake fluid may be present on outside or rear of unit. Pump runs continuously or cycles frequently (with or without brake application).

B. **"INCREASED PEDAL TRAVEL"** symptoms can be diagnosed from this bulletin. If this symptom is recognized in conjunction with "HARDER PEDAL FEEL", follow the diagnostic procedures for "harder pedal feel".

**NOTE:** Replacement of the complete Powermaster assembly is not required to correct most customer concerns. Part kits are available that will resolve most concerns with this system, and eliminate unnecessary replacement of the complete Powermaster assembly.

4

See Figures '1 and 2 for component identification.

**HARDER PEDAL FEEL DIAGNOSTICS PROCEDURE**

<u>PROCEDURE/TEST</u>	<u>RESULT</u>	<u>CORRECTIVE ACTION</u>
<b>FLUID LEVEL/EXTERNAL LEAKAGE:</b>		
Make 10 brake applies with ignition "off".  pump reservoir (Fig. 2).	Below minimum mark	Follow Corrective Action Step #1.
- or -	Above gage marks	Reservoir overfilled Remove excess fluid Continue diagnostic
- or -	Within normal level gage marks	No action required. Continue diagnostics
<b>WARNING LIGHT OPERATION:</b>		
Check red brake warning light with normal braking (Ignition "ON").	Light does not illuminate	No action required. Continue diagnostics
- or -	Light comes on and goes off	See accumulator operation diagnostic <sup>s</sup>
- or -	Light comes on and may stay on	See booster operation diagnostics.
Make a series of rapid brake applies (one pply per second).	Light comes on and goes off	No action required. Normal operation. Continue diagnostics <sup>CS</sup>

**ACCUMULATOR OPERATION:**

Make 10 brake applies with ignition "off".  
Turn ignition "on".  
Check time from motor "start" to red light off.

- or -

- or -

0-1 second

Replace accumulator P/N 18014978 or 18018722) per instructions on installation sheet.

2-7 seconds

No action required. Continue diagnostics

8 seconds or greater

Follow Corrective Action Step #2

**BOOSTER MOTOR OPERATION:**

Turn ignition on and make normal brake applies.

- or -

Motor does not run, no power assist, red warn-light illuminates.

Follow Corrective Action Step #3

Motor does not shut off within 15 seconds,

Follow Corrective Action Step #4

**INTERNAL LEAKAGE:**

Wait for pump to shut off after normal run cycle. Keep ignition "on". Wait for five minutes.

Pump cycles without a brake application being made.

Follow Corrective Action Step #2.B

**INCREASED PEDAL TRAVEL DIAGNOSTICS PROCEDURE**

(ALL MODELS)

Inspect for external leaks between master cylinder outlets and wheel brakes.

- or -

Leakage observed,

Repair leak or replace leaking part. Add fluid, to master cylinder reservoir per Figure 2.

No leakage observed.

Proceed to next step below.

(1986 STATION WAGONS ONLY)

Bleed left front caliper only.

Pedal Travel significantly improves. \*

Replace combination valve with brass valve (P/N 25509419) and rebleed total system.

-- or --

Pedal travel is still excessive. \*

Bleed total system and check drum brake adjustment.

Bleed entire brake system and check drum brake adjustment.

Pedal Travel is still excessive. \*

Repair Powermaster unit with Seal Repair Kit 18020067

(1985-87 BUICK REGAL TURBO ONLY)

Bleed entire brake system and check drum brake adjustment.

Pedal travel is still excessive. \*

Repair Powermaster unit with Seal Repair Kit 18020067

**\*NOTE:** To properly evaluate pedal travel, apply brakes with vehicle parked, ignition off, and without power assist (de-pressurize system with ten brake applies). Pedal travel on the vehicles should be a maximum of 2-1/4 inch with normally worn brake linings when checked at 100 pound pedal force using J-28662 tool.

CORRECTIVE ACTION STEPS

**STEP #1 - LOW FLUID IN BOOSTER PUMP RESERVOIR DUE TO EXTERNAL LEAK.**

A. Make ten medium to high effort brake applies with ignition off to de-pressurize the system. Check fluid level in booster pump reservoir by observing if level falls between the two gage marks located on the inside of the pump reservoir (Figure 2).

**\*NOTE:** If pressure switch has a black plastic body, the unit must be refitted with the updated pressure switch which has a gray plastic body (P/N 18018141).

B. Inspect the pressure switch and adjacent areas for external leaks. This may require wiping those areas dry and observing for fluid leakage during and after the pump motor run time. If fluid is observed, replace appropriate component.

C. With unit removed from vehicle, check for leakage at rear. Rubber boot should not have excess amounts of fluid inside. If fluid is observed, repair Powermaster with Seal Repair Kit 18020067.

D. Bleed and refill unit to proper gage level in reservoir with system in the de-pressurized state.

**STEP #2: ACCUMULATOR OPERATION TEST: PUMP RUNS MORE THAN 8 SECONDS**

- A. Check for internal leakage in diagnostics procedure. **If** pump does not self-cycle within five minutes, proceed to Step C.
- B. **If** pump self-cycles (ignition "on", no brakes applied), an internal pressure leak is present.
1. Place a short piece (6-12 inches) of flexible plastic tubing (approximately 1/4 inch-1/2 inch diameter) over Port A in the inboard pump reservoir (Figure 2). **If** leakage is occurring, fluid will rise in the tube. Repair this fault with Seal Repair Kit 18020067. **If** no leakage is found, examine Port B.
  2. Place the same plastic tubing over Port B (Figure 2). **If** leakage is observed here, repair with Check Valve Repair Kit 18018552.
- C. De-pressurize the system with ten brake applies and ignition off. Fluid level must be within gage marks in reservoir.
- D. Install J35126 tc01 and test to determine **if** fault is in motor and pump assembly or **if** fault is in the accumulator. (See NOTE BELOW.)
- E. Turn ignition on. Wait until pump motor shuts off. Turn ignition off. Slowly bleed off the accumulator pressure with J35126 bleed valve - returning fluid to the pump reservoir (inboard side, Figure 2). The gage pressure will suddenly drop to zero at the accumulator gas pre-charge point.
1. **If** the drop-off point occurs below 200 psi, replace the accumulator (P/N 18014978 or 18018722).
  2. **If** the drop-off point occurs above 200 psi, replace the pump and motor assembly (P/N 18011279).

**NOTE:** 535126 per Step 2.D. above is the preferred method. However, **if** such a tool is not available, the alternative method listed below will provide the necessary diagnostic information to determine the fault.

1. De-pressurize the system per 2.C. Turn ignition on and check the time from motor start running to motor stop running.
2. **If** time to motor shut-off is less than 15 seconds, replace the accumulator.
3. **If** the time to motor shut-off is more than 15 seconds, replace motor and pump assembly and then retest accumulator per Accumulator Operation Test (Step #2 above). **If** run time on that test is still greater than 8 seconds, also replace the accumulator.

### STEP #3: BOOSTER PUMP MOTOR DOES NOT RUN

Confirm that the 30 amp brake system fuse is not defective, otherwise replace. Next, disconnect the pressure switch and pump motor electrical connectors and conduct the following electrical circuit checks:

#### A. Pressure Switch (Ohmmeter Test)

1. De-pressurize system by pumping brake pedal at least ten times with ignition switch off.
2. Using suitable ohmmeter, all terminals should have continuity with each other. If not, switch must be replaced.

#### B. Booster Motor (Ohmmeter Test)

1. Meter should show resistance between motor terminals "B" and "D".
2. Meter should indicate open circuit between motor terminals "A" and "C".
3. Replace motor and pump assembly if above conditions are not met.

#### C. Pressure Switch Connector and Harness (Volt-Ohmmeter Test)

1. Make sure parking brake is released.
2. With ignition on, using a suitable ohmmeter, pressure switch terminal "A" should show continuity with motor terminal "D".
3. With ignition on, using a suitable voltmeter, pressure switch terminal "B" should be 12 volts relative to vehicle chassis ground.
4. If voltage at pressure switch terminal "B" is low or zero, disconnect electrical connector from combination valve. If voltage at "B" is now normal, combination valve wire harness or switch is at fault. If voltage at terminal "B" remains low or zero, red brake warning light circuit is defective.
5. If any of the above tests fail, wire harness and electrical connections must be replaced or repaired.

#### D. Pump Motor Connector and Harness (Volt-Ohmmeter Test)

1. With ignition on, using suitable ohmmeter, motor terminal "A" should show continuity with vehicle chassis ground.
2. With ignition on, using suitable voltmeter, motor terminal "B" should show 12 volts relative to chassis ground.

3. With ignition on, using suitable voltmeter, motor terminal "C" should show 12 volts relative to chassis ground.  
**NOTE:** This is the main electrical supply to the motor. If voltage is not present, check the **30** amp brake system fuse.
4. Recheck terminal "D" as per Step **3.C.1** above.
5. If **any** of the above tests fail, wire harness and electrical connections must be replaced or repaired.

**STEP #4: MOTOR DOES NOT TURN OFF WITHIN 15 SECONDS (IGNITION "ON")**

- A. Check fluid level per Step 1.A.
- B. Install 535126 Tool per Step 2.D, and test to determine if fault *is* in motor and pump assembly, pressure switch, or internal booster leakage.
- C. Turn ignition on. Wait **20** seconds, Monitor booster pressure on **535126** gage.
  1. If pressure exceeds 770 psi, replace pressure switch.
  2. If pressure does not reach the **540 psi - 770 psi** pump shut-off range, check Port A and Port B in the booster pump reservoir (Figure 2) per Step 2.8, above. If fluid is flowing in either port, the booster is leaking internally. Repair unit with Seal Repair Kit 18020067. If fluid is not flowing in either port, the motor and pump assembly is defective (unable to provide the required pressure) and should be replaced.



## REFERENCES

### 1. Available Repair Kits:

The following repair kits are available to assist in servicing the Powermaster brake units. The labor times indicated include time for the functional system check and diagnostic procedures.

<u>P/N</u>	<u>DESCRIPTION</u>	<u>LABOR OP. NUMBER</u>	<u>LABOR TIME NUMBER</u>
18011279	Pump and Motor Asm. Package	H0980	0.8 Hr.
18018141	Pressure Switch Asm. Package	H0778	0.4 Hr.
18014978	Accumulator Asm. Package (Excludes '85 Turbo)	H0985	0.3 Hr.
18018722	Accumulator Asm. Package ( '85 Turbo Only)	H0985	0.3 Hr.
18013293	Res. Cover Asm. (Exc, '85 Turbo)	H0610	0.2 Hr.
18011388	Res. Cover Asm. ('85 Turbo)		
18011412	Push Rod & Retainer (Sta. Wgn.)		
18011544	Push Rod & Ret'nr. (Exc. Sta. Wgn.)		
18020512	Res. & Grommet Pkg. (Sta. Wgn.)		
18020513	Res. & Grommet Pkg. ('85 Turbo)		
18020514	Res. & Grommet Pkg. ('86-87 Turbo)		
18011398	Boot Package	T1377	0.4 Hr.
18010875	Bracket Package (Sta. Wgn.)	T1378	1.1 Hr.
18010877	Bracket Package (Exc. Sta. Wgn.)		
18011403	Sump Hose Package	H0745	0.3 Hr.
25509419	Brake Combination Valve	H0780	0.7 Hr.
18018552	Check Valve Asm. Package		
18020067	PM-1 Repair Kit	H1300	2.0 Hr.
18020511	High Pressure Hose Package.		

### 2. Pump Operating Pressure Ranges:

Pump Off	540-770 psi
Pump On	490-610 psi
Light On	340-500 psi

**NOTES:** During normal operation the pump will run every 2-4 brake applies.

Pump on pressure level must always be at least 100 psi less than pump off pressure level.


### 3. System Bleeding:


A problem may be encountered in bleeding the Powermaster unit if for any reason the pump has not been properly filled with brake fluid. If after any service or new installation the pump does not circulate fluid within 20 seconds motor run time, it may be necessary to reprime the pump. In order to reprime the system, the following steps should be followed:

- A. Turn ignition off.
- B. Apply the brake pedal with medium to firm pressure 10-15 times to de-pressurize the system. Check reservoir level and fill if required.
- C. Clean and remove the reservoir cover.
- D. Disconnect the booster tube and nut assembly from the casting boss at the pump outlet located adjacent to the pressure switch assembly (Figure 1).
- E. Wait for brake fluid to appear from the disconnected outlet normal gravity bleeding.
- F. When brake fluid begins to flow, reconnect the tube nut and torque to 17 N.m (13 lb.ft.).
- G. Recheck the fluid level in the reservoir and add new brake fluid as needed. Reinstall the reservoir cover.
- H. Turn ignition on. The pump should now fill the accumulator properly and shut off within 15 seconds. The fluid level on the inboard pump reservoir should diminish. (DO Not refill. Gage marks are only to be used with de-pressurized system.)
- I. Continue with Service Manual bleed and fill procedures.

**Part Availability:**

Parts are currently available from GMSPO except for part number 18011279 expected to be available on 2/8/93.

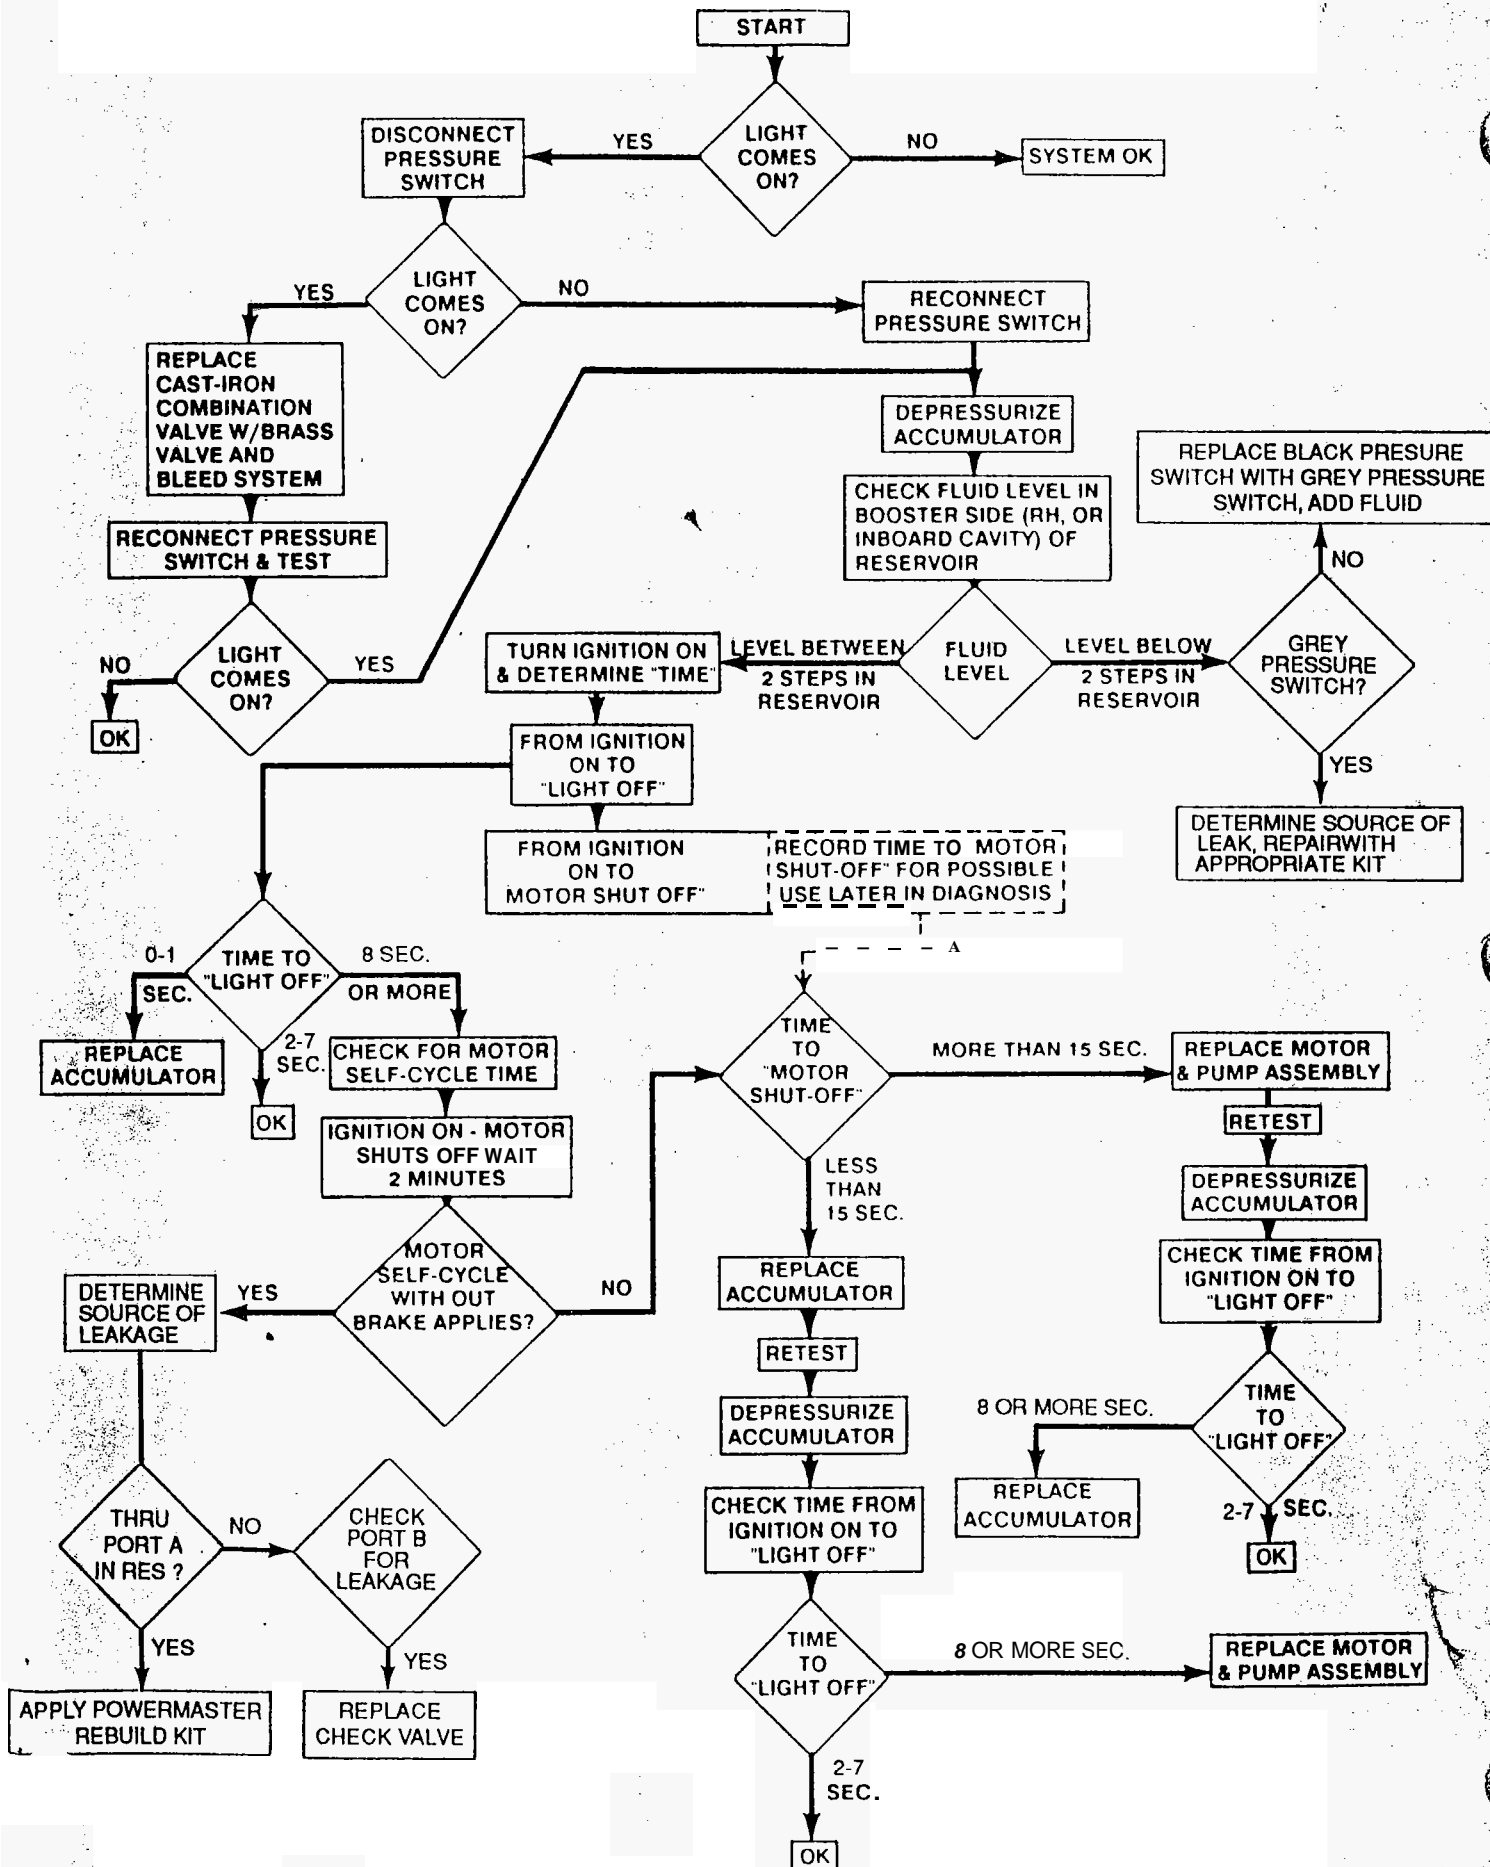

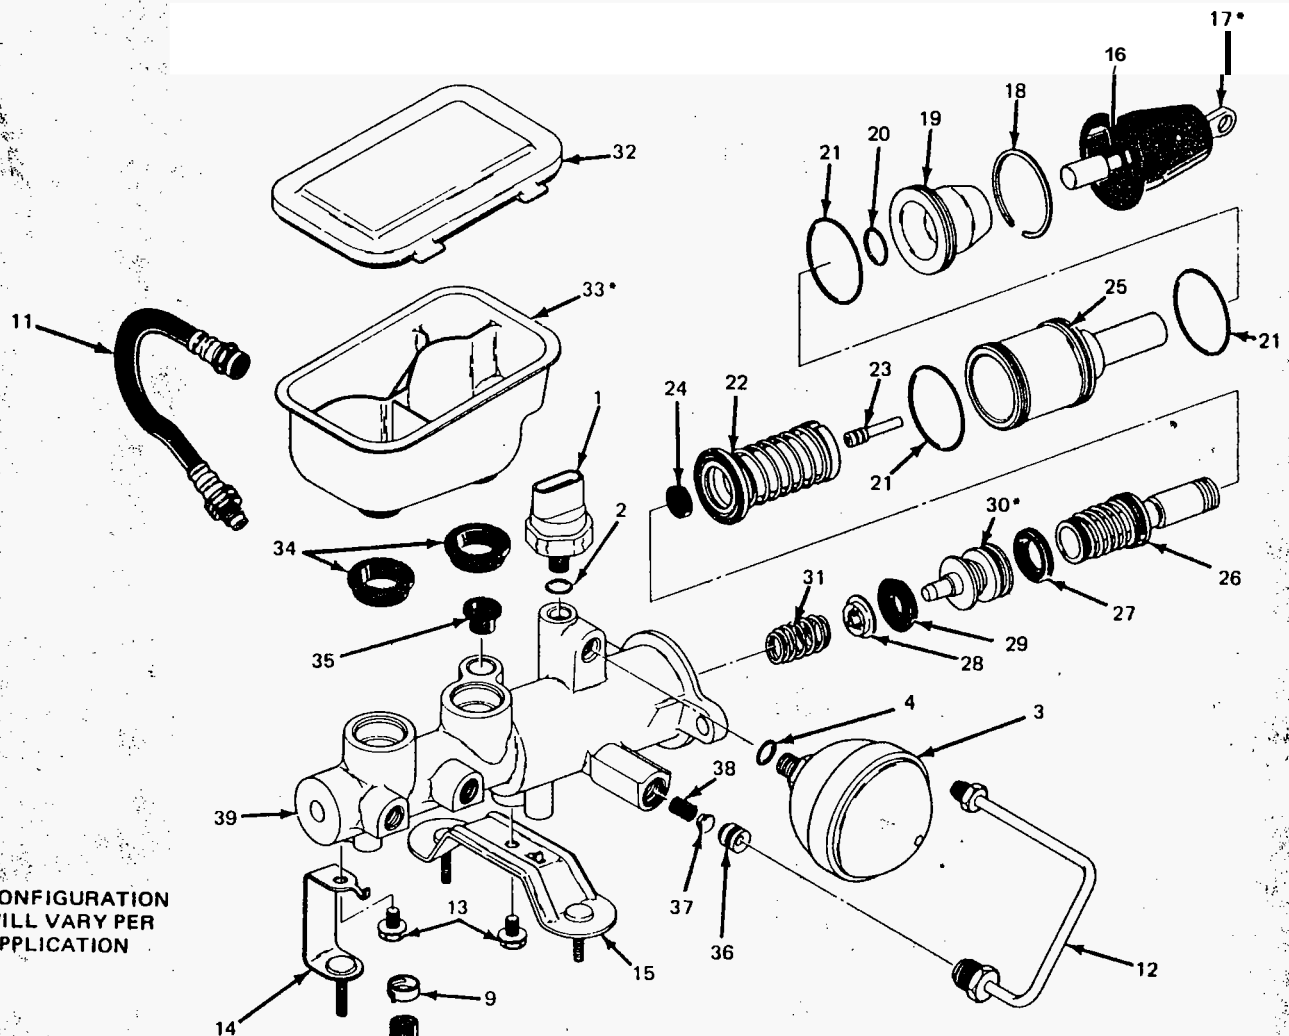


\* CONFIGURATION  
WILL VARY PER  
APPLICATION

- 1. PRESSURE SWITCH
- 2. O-RING
- 3. ACCUMULATOR
- 4. O-RING
- 5. NUT
- 6. WASHER
- 7. GROMMET
- 8. E-H PUMP
- 9. HOSE CLAMP
- 10. SUMP HOSE
- 11. PRESSURE HOSE ASSEMBLY
- 12. TUBE & NUT ASSEMBLY
- 13. BOLT
- 14. BRACKET ASSEMBLY
- 15. BRACKET ASSEMBLY
- 16. RETAINER
- 17. BOOT, PUSHROD, SOCKET GROUP
- 18. RETAINER
- 19. PISTON GUIDE
- 20. O-RING
- 21. O-RING

- 22. REACTION BODY GROUP
- 23. REACTION PISTON
- 24. REACTION DISC
- 25. POWER PISTON ASSEMBLY
- 26. PRIMARY PISTON ASSEMBLY
- 27. SECONDARY SEAL
- 28. SPRING RETAINER
- 29. PRIMARY SEAL
- 30. SECONDARY PISTON
- 31. SPRING
- 32. RESERVOIR COVER AND DIAPHRAGM
- 33. RESERVOIR
- 34. RESERVOIR GROMMET
- 35. RESERVOIR GROMMET
- 36. VALVE SEAT AND SEAL
- 37. POPPET
- 38. SPRING
- 39. POWERMASTER BODY

Figure 1

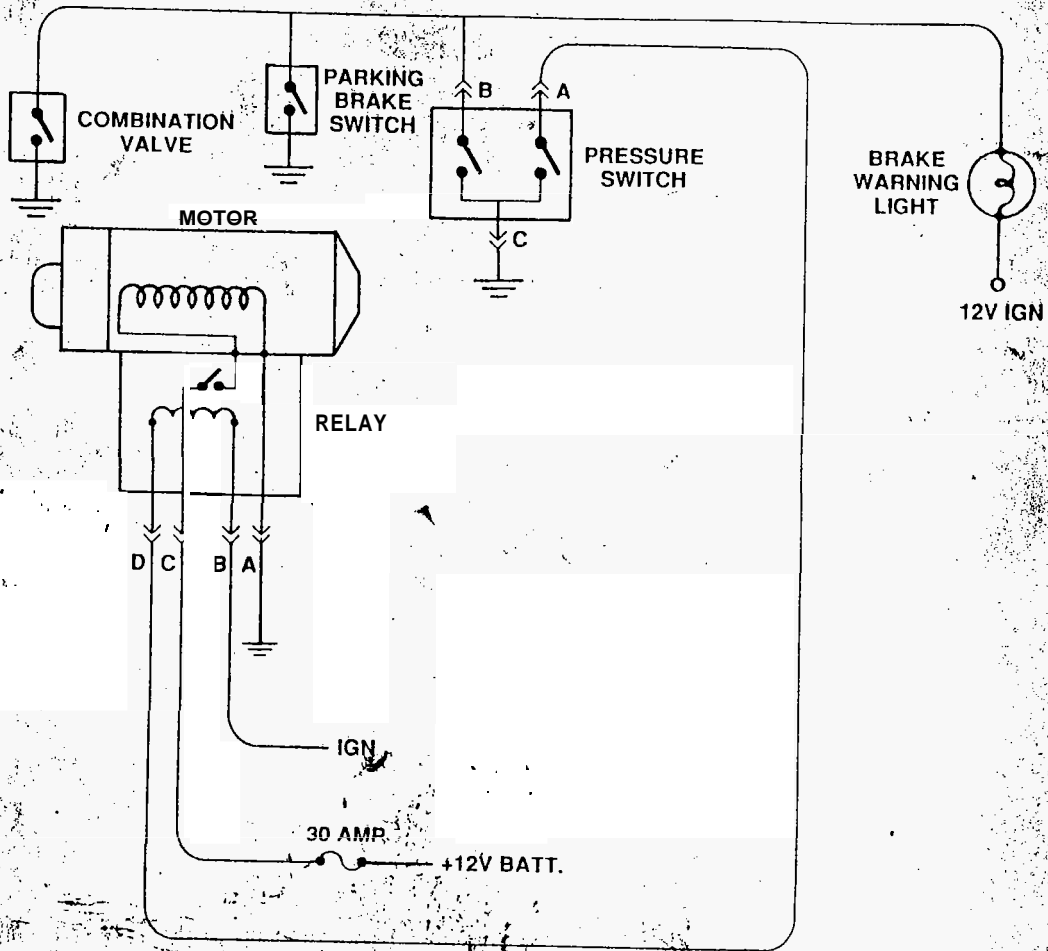

## POWER MASTER BRAKE SYSTEM

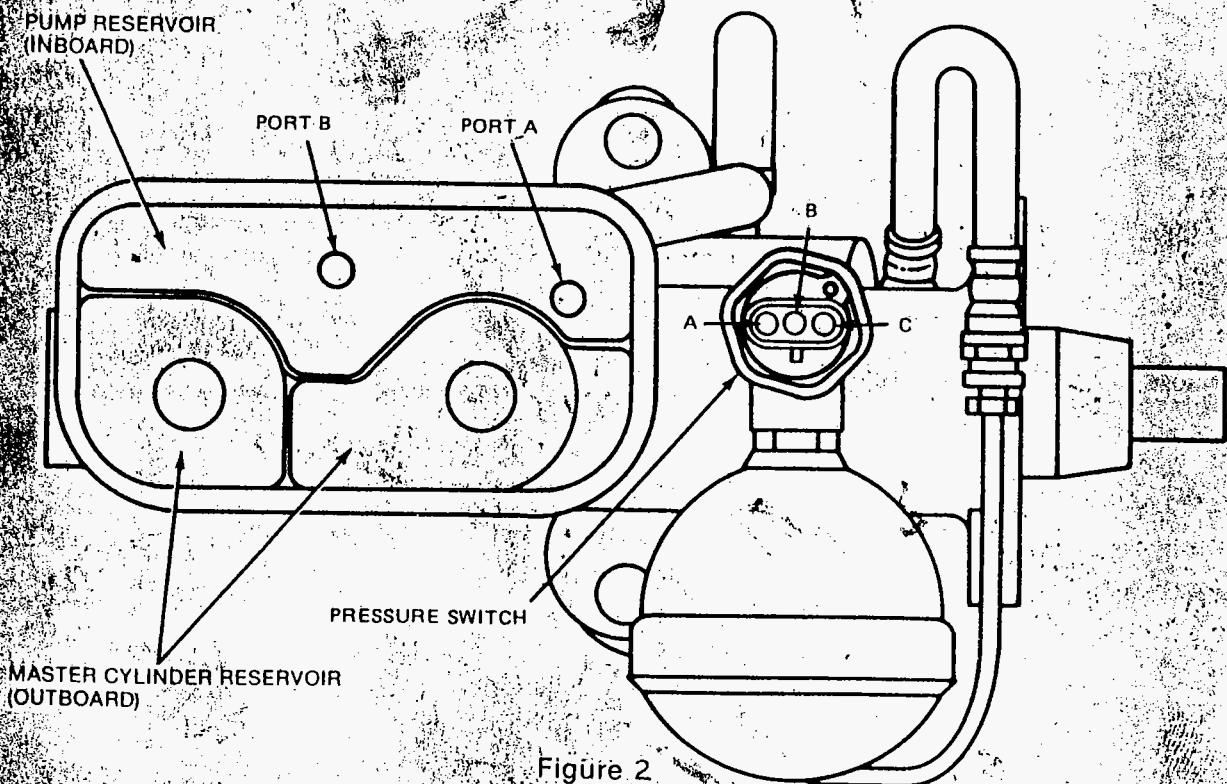


Figure 2

